What's in the Box?

One (1) of the following devices:

- SKXPro/SKX5 SLED-mPOS Companion
- SKXPro/SKX5 SLED-MSRIC Companion


And:

1 contact PCB



0000 IIIII


1. Using tweezers, carefully remove all four (4) screw caps from the back of the SKXPro/SKX5. Then, remove all (4) screws from the back of the SKXPro/SKX5. (A)

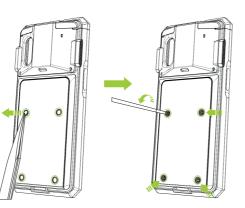


3. Attach the contact PCB to the SKXPro/SKX5. (C)

*SKXPro/SKX5 sold separately. Tweezers and PH0 screw driver (not included) will be necessary to complete assembly.

2. Separate the companion cover from the SKXPro/SKX5 by removing the terminal protective tape with tweezers. (B)

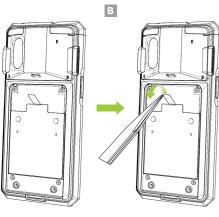

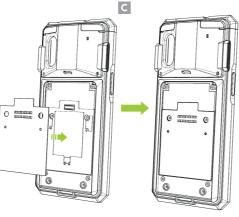


Additional Accessories

- ▶ 0.5W UHF Reader Companion
- ▶ 1.0W UHF Reader Companion
- 2000mAh Extended Battery Companion
- Pistol Grip Companion (battery optional)
- SKXPro/SKX5 1-Slot Charging Cradle
- SKXPro/SKX5 5-Slot Charging Cradle
- XCover Pro/XCover 5 1-Slot Charging Cradle XCover Pro/XCover 5 5-Slot Charging Cradle

ΚΟΛΜΤΛΟ

116 Village Blvd, Ste 305, Princeton, NJ 08540 +1 609-256-4700 p | +1 609-228-4373 f info@koamtac.com www.koamtac.com

4. Align the screw holes of the SLED-mPOS or SLED-MSRIC Companion with the screw holes of the SKXPro/SKX5. Use the four (4) included screws to attach the SLED-mPOS or SLED-MSRIC Companion to the SKXPro/SKX5. (D)

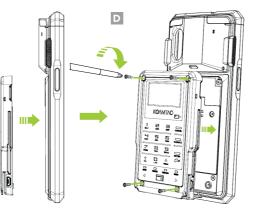

KOVMLVC

SKXPro/SKX5 SLED-mPOS/SLED-MSRIC **Assembly Manual**



5. Attach the four (4) included screw caps to the SKXPro /SKX5 SLED-mPOS or SLED-MSRIC Companion. (E)

